


UNITÀ DI MASCHIATURA - TAPPING UNIT
GEWINDESCHNEIDEINHEIT -
UNITE DE TARAUDAGE - UNIDAD DE ROSCAR

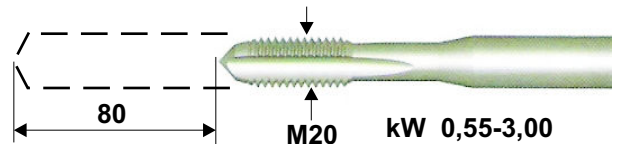

ORDERING REFERENCES

T20/B/4.0/00B/1/ *

T= UNITÀ DI MASCHIATURA - TAPPING UNIT -
 UNITE DE TARAUDAGE - GEWINDESCHNEIDEINHEIT -
 UNIDAD DE ROSCAR

20= M20 CAPACITÀ MASCHIATURA SU ACCIAIO
 TAPPING CAPACITY IN STEEL
 CAPACITE TARAUDAGE ACIER
 SCHNEIDLEISTUNGEN IN STAHL
 CAPACIDAD ROSCAR EN ACERO
 500N/ mm²

B= 0-80mm CORSA CON PATRONA
 MECHANICAL FEED
 AVANCE PAR PATRONNE
 MECHANISCHER VORSCHUB
 CARRERA CON HUSILLO PATRÓN

4.0= MORSE 2 DIN 228 STANDARD
5.0= ER20
6.0= DIN 55058 Ø16
7.0= DIN 55058 Ø20

00= 80- kW 0,75- POLES 4 STANDARD
01= 90- kW 1,10 POLES 4
02= 90- kW 1,50 POLES 4
03= 90- kW 0,75 POLES 6
04= 90- kW 1,10 POLES 6
07= 100- kW 2,20 POLES 4
08= 100- kW 1,50 POLES 6
09= 100- kW 3,00 POLES 4

B= MOTORE AUTOFRENANTE - BRAKE MOTOR -
 MOTEUR FREIN - BREMSMOTOR -
 MOTOR CON AUTOFRENADO **OPTION**

MANDRINO
 TOOLHOLDER
 NEZ DE BROCHE
 WERKZEUGAUFNAHME
 HUSILLO

MOTORE
 MOTOR
 MOTEUR
 MOTOR

Coppia max trasmissibile - Max transmission torque
 Couple max. transmissible - Max übertragbares Drehmoment
 Momento torsional transmissible **80Nm**

PASSO PATRONA - LEAD SCREW PITCH -
PAS DE LA PATRONNE - STEIGUNG DER LEITPATRONNE -
PASO HUSILLO PATRÓN

Riduttore - Reducer - Réducteur
 Getriebe - Reductor **Hz50 Hz60 MOTOR**

GIRI MANDRINO
SPINDLE RPM
VITESSE DE BROCHE
SPINDELDREHZAHL
VELOCIDAD HUSILLO


Catena - Chain - Chaîne
 Kette - Cadena **06B**

Cinghia dentata
 Timing belt
 Courroie crantée
 Zahnriemen
 Correa dentada **L100**



Altre velocità a richiesta - Other rpm on request - Autres
 vitesses sur demand - Andere Drehzahl auf Anfrage -
 Otras velocidades a solicitud



Page 90

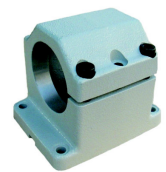

Page 92

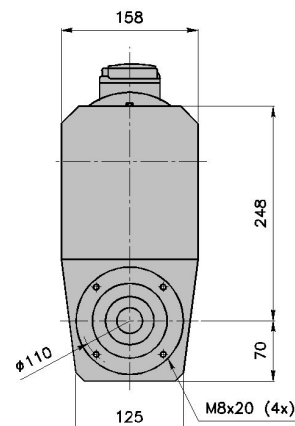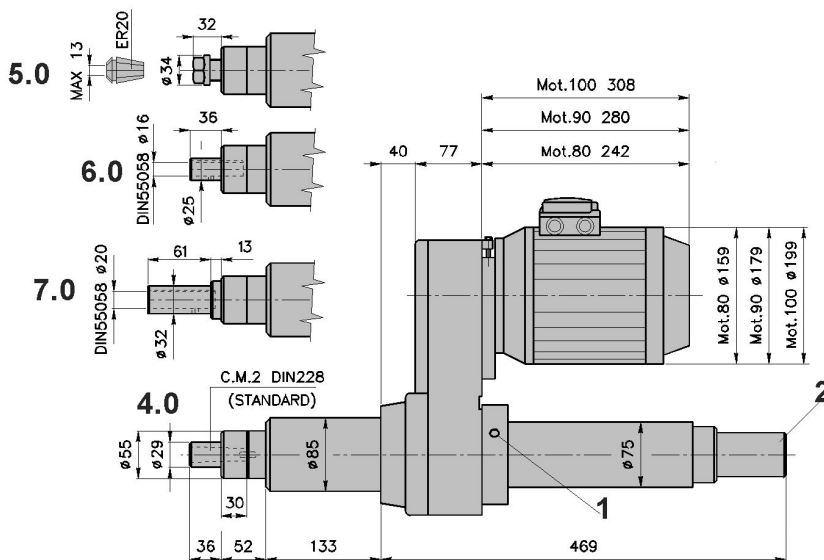

1	PG11 Ingresso cavi per fine corsa elettrici interni. (Sensori induttivi in opzione).	PG11 Electric wires connections for electric limit switches. (Proximity sensors as option).	PG11 Passage câble des fins de course électriques. (Capteurs inductifs en option).	Pg11 Kabelanschluss der Endschalter. (Induktivenschalter (Option).	PG11 Conexión por interruptores eléctricos. Sensores en opción.
2	Patrona in bagno d'olio. Cambio patrona facile. Sicurezza per patrona.	Lead screw in oil bath. Easy to change lead screw. Load sensing safety switch.	Patronne à bain d'huile rapidement interchangeable. Fin de course sécurité patronne.	Ölbadschmierung der Leitspindel. Schnelles Auswechseln der Leitspindel. Kernlochkontrolle.	Patrón en baño de aceite. Fácil sustitución del patrón. Controllo piezas sin agujero.
	Peso kg 29-51 Colore Grigio RAL 7038	Weight kg 29-51 Color grey RAL 7038	Poids kg 29-51 Couleur gris RAL 7038	Gewicht kg 29-51 Farbe hellgrau RAL 7038	Peso kg 29-51 Color gris RAL 7038